

Date Investigated	Date Damaged	DPA Site Visit?	RSA Score	Assigned Locator
8/26/2026	8/26/2026	yes	Very high	Gabe Nealon

District	UDIG #	WR/CLAIM #	GRO #
Central	07016-000-080	WR#20000148644	818352

Facilities Facts Location of Rip-up

Street Address	Town	County
800 S Wilbur Ave	Syracuse	Onondaga

Facilities Damaged:

4-inch Plastic Service

Comments/Remarks:

Work Being Performed: JK Tobin installing a roadway/utility with a valid dig ticket hit a correctly marked 4-inch Plastic gas stub service with an excavator. This service was a live stub onto the property a total of 164 feet. This stub was marked with paint and flags indicating the end of stub with a test station and a marker ball. Contractor was informed by the City of Syracuse that this service was stubbed at the property line and the design blueprints supported that. Contractor was removing all 4-inch plastic with an excavator due to conflict with new roadway under the impression it was retired. This 4-inch service was correctly marked, positive response to ticket indicated it was marked. There were 6 houses evacuated, approx. 15-20 people. **NYCRR Part 753-3.6-verification of underground facilities.**

DPA site, not on site, advisor closed ticket, DPS on site, pending citation with follow up meeting, GFO made safe, stubbed at property line

(5) (D4.21) (3.3)

Excavator Information

Excavator	Damage Reason Code	Interruption?	# of custs
Joe Mueller	(5) (D4.21) (3.3)	No	0

Comments/Remarks (Responsible Party):

JK TOBIN
5146 JAMESVILLE RD JAMESVILLE, NY 13078
[315-446-1480 mjd@jktobin.com](mailto:mjd@jktobin.com)

Report Completed by:	Job Title	Region
Chris Fellows	Supervisor	Central



From locate video





4-inch Plastic service pipe removed uphill of active stub

Damage to 4-inch end cap of stub





Markout from locator video




5

GAS STUB

FORM
638-013

NO. 27867884	HOUSE NO. 800	STREET OR ROAD S. Wilbur Ave	ST. CODE LINE NO.	TOWN - VILLAGE - CITY Syracuse	TAX DIST. NO.	DATE REC'D.	BY								
OWNER		PHONE NO.	TYPE OF ENTRY ☐ INSTALL ☐ REMOVE ☐ ADD'L ☐ RELOC.		DIST. NO.										
CONTRACTOR		PHONE NO.	DATE SCHEDULED	LOAD	ZONE NO.										
SEND BILL FOR CHARGES TO PREM 660999800		CHARGES TO BE COLLECTED ☐ YES ☐ NO		FOR _____ FEET											
SALES ORDER	AMOUNT	DATE PAID	REMARKS ★ Service is 42" Deep ★												
HISTORY	MAIN END					HOUSE END					TOTAL FEET	FEET ON PRIVATE PROPERTY	SERVICE PROPERTY UNITS		
	YEAR	ORDER NO.	SIZE	KIND	FEET	YEAR	ORDER NO.	SIZE	KIND	FEET					
AS IS FROM LAST ORDER	1992	76921	4"	P-6	50	1992	76921	4"	P-6	633	683	633	2		
RETIREMENT THIS ORDER						1992	76921	4"	P-6	519	59	59			
INSTALLED THIS ORDER															
AS IS THIS DATE	1992	76921	4"	P-6	50	1992	76921	4"	P-6	114	164	114			
P R CODE															
LOCATION OF FACILITIES													REGULATOR #		
ITEM	FEET	INCHES	N-E-S-W	OF	BLDG. LINE	ITEM	FEET	INCHES	N-E-S-W	OF	☒ CURB LINE ☐ PROP. LINE ☐ CENTER LINE				
SERVICE	24	0	N	SOUTH	STREET	MAIN	10	0	E	E					
SERVICE	52	0	S	E Seymour		MAIN	28	0	E	E Wilbur Ave					
SERVICE	31	0	S	Curb Line		SIZE MAIN	12	"	KIND MAIN ☐ CI ☒ ST ☐ PL	YEAR INSTALLED	1973				
CURB BOX					☐ CURB LINE ☐ BLDG. LINE ☐ PROP. LINE	PRESSURE			☐ L ☒ H	STREET WIDTH	50'				
CURB BOX						COMPLETED BY	Am Castelli					DATE	9-10-19		
STUB	BLANKET														

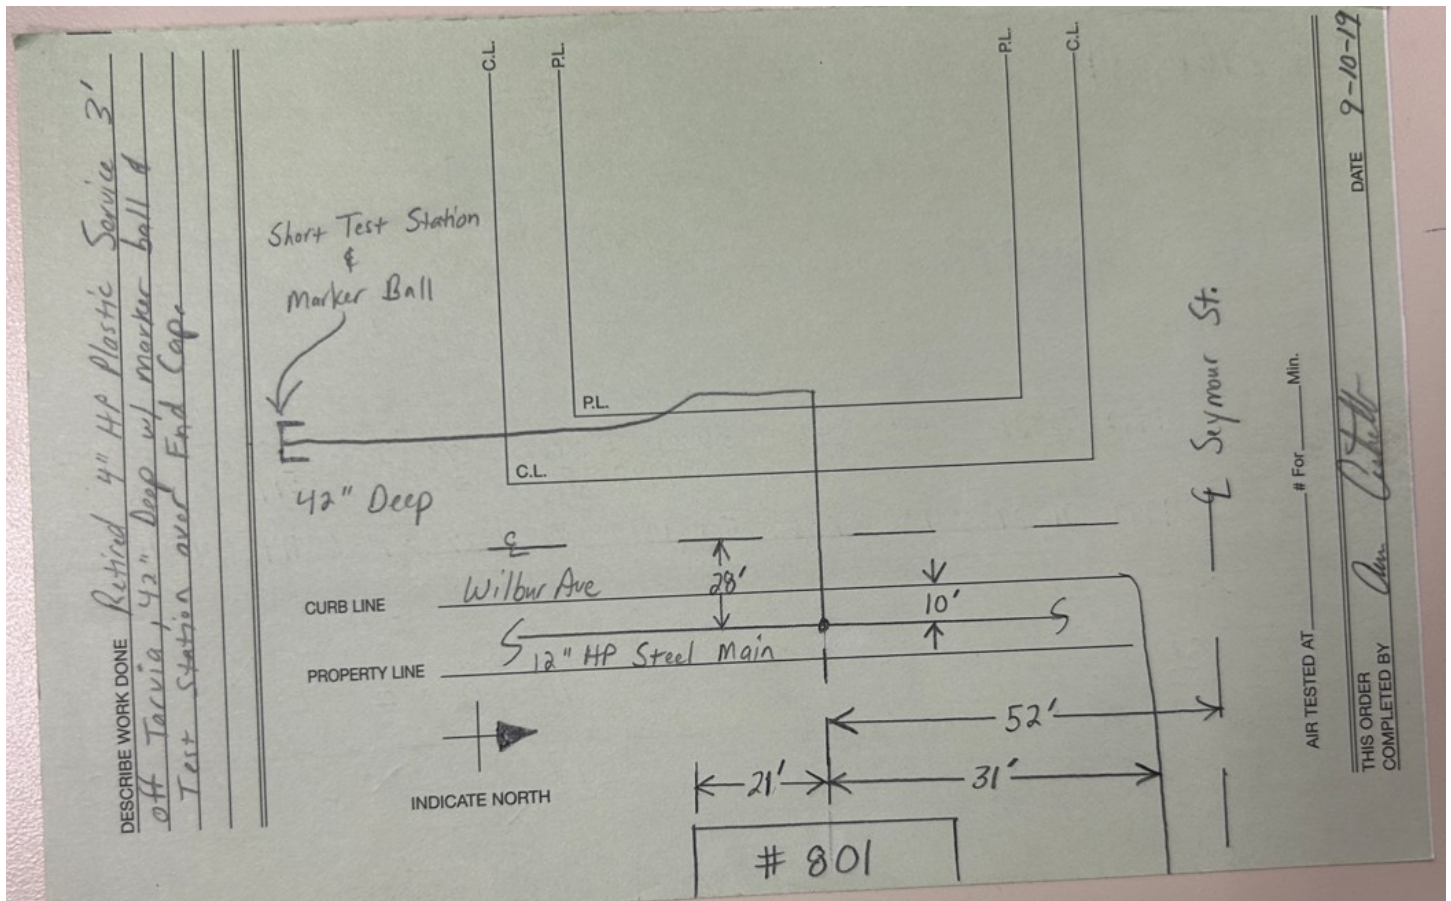

Gas Loss Due To Damage

Inputs:

Time Company Notified [24HR]	Time Gas Leak Made Safe [24HR]	Total Time Gas Blowing
11:33:00	14:05:00	2:32:00
Operating Pressure [PSIG]	Area of Puncture [SQ-IN]	Time in Decimal Hours
24	3	2.53

Less than 12 PSIG:

Gas Loss Rate [MCFH]	Gas Loss [MCF]
NA	NA

Greater than or equal to 12 PSIG:

Gas Loss Rate [MCFH]	Gass Loss [MCF]
107.27	271.76